

Control Number: 43241



Item Number: 6

Addendum StartPage: 0

*House Bill (HB) 1600 and Senate Bill (SB) 567 83rd
Legislature, Regular Session, transferred the functions
relating to the economic regulation of water and sewer
utilities from the TCEQ to the PUC effective
September 1, 2014.*

Bryan W. Shaw, Ph.D., *Chairman*
Carlos Rubinstein, *Commissioner*
Toby Baker, *Commissioner*
Zak Covar, *Executive Director*

RECEIVED

2014 SEP 22 PM 3:54

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

PUBLIC UTILITY COMMISSION
FILING CLERK

Protecting Texas by Reducing and Preventing Pollution

July 9, 2013

CERTIFIED MAIL #7010 2780 0002 1568 9969
RETURN RECEIPT REQUESTED

Ms. Peggy Paul, President
Orbit Systems, Inc.,
1302 Airline N.
Rosharon, Texas 77583-7718

Re: Notice of Violation for the Comprehensive Compliance Investigation at:
Demi John I S Water System, 207 Flounder Circle, Brazoria County, Texas
Regulated Entity No.101192078, TCEQ ID No. 0200234 Investigation No.1095457

Dear Ms. Paul:

On June 11, 2013, Mr. Barry Price and Ms. Latrichia Spikes of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced regulated entity to evaluate compliance with applicable requirements for Public Water Supply. Enclosed is a summary which lists the investigation findings. During the investigation, some concerns were noted which were alleged noncompliances that have been resolved as Areas of Concern based on subsequent corrective action. In addition, a certain outstanding alleged violation was identified for which compliance documentation is required. Please submit to this office by September 30, 2013 a written description of corrective action taken and the required documentation demonstrating that compliance has been achieved for the outstanding alleged violation. Furthermore, please see the attached Additional Issue.

In the listing of the alleged violation, we have cited applicable requirements, including TCEQ rules. Please note that both the rules themselves and the agency brochure entitled *Obtaining TCEQ Rules* (GI 032) are located on our agency website at <http://www.tceq.texas.gov> for your reference. If you would like a hard copy of this brochure mailed to you, you may call and request one from either the Houston Region Office at Phone (713)767-3650 or the Central Office Publications Ordering Team at (512)239-0028.

The TCEQ appreciates your assistance in this matter. Please note that the Legislature has granted TCEQ enforcement powers which we may exercise to ensure compliance with environmental regulatory requirements. We anticipate that you will resolve the alleged violations as required in order to protect the State's environment. If you have additional information that we are unaware of, you have the opportunity to contest the violations documented in this notice. Should you choose to do so, you must notify the Houston Region Office within 10 days from the date of this letter. At that time, PWS Team Leader Ms. Leticia De Leon, will schedule a violation review meeting to be conducted within 21 days from the date of this letter.

Ms. Peggy Paul, President

Page 2

July 9, 2013

If you or members of your staff have any questions, please feel free to contact Mr. Barry Price in the Houston Region Office at (713)767-3650.

Sincerely,



Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/BHP/ra

cc: Brazoria County Public Health and Environmental Services

Enclosures: Summary of Investigation Findings

Summary of Investigation Findings

DEMI JOHN I S WATER SYSTEM

Investigation #

1095457
Investigation Date: 06/11/2013

, BRAZORIA COUNTY,

Additional ID(s): 0200234

OUTSTANDING ALLEGED VIOLATION(S) ASSOCIATED TO A NOTICE OF VIOLATION

Track No: 505325 Compliance Due Date: 09/30/2013

30 TAC Chapter 290.45(b)(1)(D)(iii)

Alleged Violation:

Investigation: 1095457

Comment Date: 07/01/2013

Capacity Requirements

Failure to provide a minimum service pump capacity such that each pump station or pressure plane must have two or more pumps with a total capacity of 2.0 gallons per minute per connection, or a total capacity of 1,000 gallons per minute and be able to meet peak hourly demands with the largest pump out of service, whichever is less at each pump station or pressure plane.

At the time of the inspection, the facility had a total of 98 conn. and is required to provide 2 gallons per minute(gpm) per conn. Your service pumps produced a total of 166 gpm and are short a total of 30 gpm. This is calculated in the following manner:

Required 2 gpm /conn. X 98 conn. = 196 gpm Total
Short 196 gpm Required - 166 gpm Produced = 30 gpm Total

Your water system must be modified to meet this requirement to assure an adequate supply of water at all times.

Please be advised that public water systems shall notify the executive director prior to making any significant change or addition to the system's production, treatment, storage, or distribution facilities. Public water systems shall submit plans and specifications for the proposed changes upon request.

The water system may request an exception to these requirements by writing to TCEQ, Water Supply Division, Public Drinking Water Section, Technical Review & Oversight, MC 159, P.O. Box 13087, Austin, TX 78711-3087; phone: (512) 239-4691.

Recommended Corrective Action: Submit photo, receipt, invoice, work order, or copy of an exception letter to verify compliance.

AREA OF CONCERN

Track No: 505284

30 TAC Chapter 290.41(c)(3)(K)

Alleged Violation:

Investigation: 1095457

Comment Date: 06/14/2013

Ground Water Sources and Development

Failure to face the screened well casing vent on well #2 downwards and elevate it so as to minimize the drawing of contaminants into the well. Failure to properly screen the well casing vent of well #2 with a 16-mesh or finer corrosion-resistant screening material.

The casing vent on well #2 terminated facing upwards without any screen. The extension that would face downwards and would have the 16-mesh or finer screening material was missing from the casing vent on well #2.

Recommended Corrective Action: Submit photo, receipt, invoice, or work order to verify compliance.

Resolution: The water system provided a work order dated 06/12/2013, that showed that the well casing vent on well #2 had been repaired and was now in compliance with agency rules.

Track No: 505286

30 TAC Chapter 290.46(t)

Alleged Violation:

Investigation: 1095457

Comment Date: 06/14/2013

Operating Practices for Public Water Systems

Failure by a community water system to post a legible sign at each of its production, treatment, and storage facilities. The sign must be located in plain view of the public and must provide the name of the regulated entity and an emergency telephone number where a responsible official can be contacted.

At the time of the inspection the investigator observed that the sign was missing at the 207 Flounder Circle water plant. There was no sign at the water plant that gave the name of the water system and emergency telephone number where a responsible official could be reached.

Recommended Corrective Action: Submit photo, receipt, invoice, or work order to verify compliance.

Resolution: The water system provided a picture showing that an appropriate facility sign has been installed at the water plant.

ADDITIONAL ISSUES

Description

Additional Comments

Item 4

Adequacy of Water Utility Service: [30 TAC, §291.93(3)]

Failure, by a retail public utility that possesses a certificate of public convenience and necessity that has reached 85% of its capacity as compared to the most restrictive criteria of the commission's minimum capacity requirements in Chapter 290 T.A.C., to submit to the executive director a planning report that clearly explains how the retail public utility will provide the expected service demands to the remaining areas within the boundaries of its certificated area. A report is not required if the source of supply available to the utility service provider is reduced to below the 85% level due to a court or agency conservation order unless that order is expected to extend for more than 18 months from the date it is entered in which case a report shall be required.

(A) After any commission field inspection, a retail public utility must analyze the system's capacity to determine if it has reached 85% of its capacity. If the retail public utility has reached 85% of its capacity, it must file this report no later than 90 days after the date of a commission letter detailing the results of the inspection. Capacity is considered to be the overall rated capacity in number of residential connection equivalents based on the most restrictive criteria for production, treatment, storage, or pumping.

(B) The report should be submitted in writing and should contain the following:

(i) a brief description of the overall utility system and service area;

(ii) an analysis of the plant capacity as defined in subparagraph (A) of this paragraph;

(iii) details on how the retail public utility will provide service to the remaining areas within the boundaries of its certificated area. This includes projections of cost and expected design and installation dates for additional facilities.

(C) The executive director may waive or limit the reporting requirements if the retail public utility demonstrates

Item 5

that the projected growth of the area will not require the retail public utility to exceed 100% of its current capacity for the next five years.

(D) Any retail public utility required to file reports under this section of the rules, including those requesting waivers, shall file updated reports within 90 days after the retail public utility receives a copy of each subsequent commission field inspection report until the system demand is below 85% capacity.

Specifically, it is noted on this investigation that your (well, service pump, ground storage tank, pressure tank,) has reached 98% of its capacity. This was based on 98 connections.

Submit a planning report within 90 days to TCEQ, Water Supply Division, Public Drinking Water Section, Technical Review & Oversight, MC 159, P.O. Box 13087, Austin, TX 78711-3087; phone (512) 239-4691.

ORBIT SYSTEMS, INC.

Orbit Systems, Inc.
1302 Airline North
Rosharon TX 77583

September 10, 2013

Mr. Barry Price
TCEQ
Region 12
5425 Polk Avenue, Suite H
Houston, Texas 77023-1423

Dear Mr. Price:

Subject: Public Water Supply, Demi John Island, ID#0200234, Brazoria County, Texas

On June 11, 2013, a sanitary survey was conducted at the subject water system. The following actions will be taken as a result of the item of noncompliance:

Failure to provide a minimum service pump capacity such that each pump station or pressure plane must have two or more pumps with a total capacity of 2.0 gallons per minute per connection – There are two service pumps at the water plant with the following nameplates:

- Goulds Model 3BFIJIAO, 5 15/16" diameter impeller – At 115 ft head, pump curve shows pump capacity at 125 gpm. Please see attached photo of nameplate for this pump and corresponding pump curve..
- Myers Model 150M5, 5 15/16" diameter impeller – At 115 ft head, pump curve shows pump capacity at 125 gpm. Please see attached photo of nameplate for this pump and corresponding pump curve.


Combined capacity for the two service pumps is 250 gpm providing 2.55 gpm per connection at 98 connections. This should meet service pump capacity requirements for the subdivision.

If you have any questions or require further information regarding these actions, please contact me at the above address or telephone 281-369-2041.

Sincerely,




Peggy Paul
Orbit Systems, Inc.

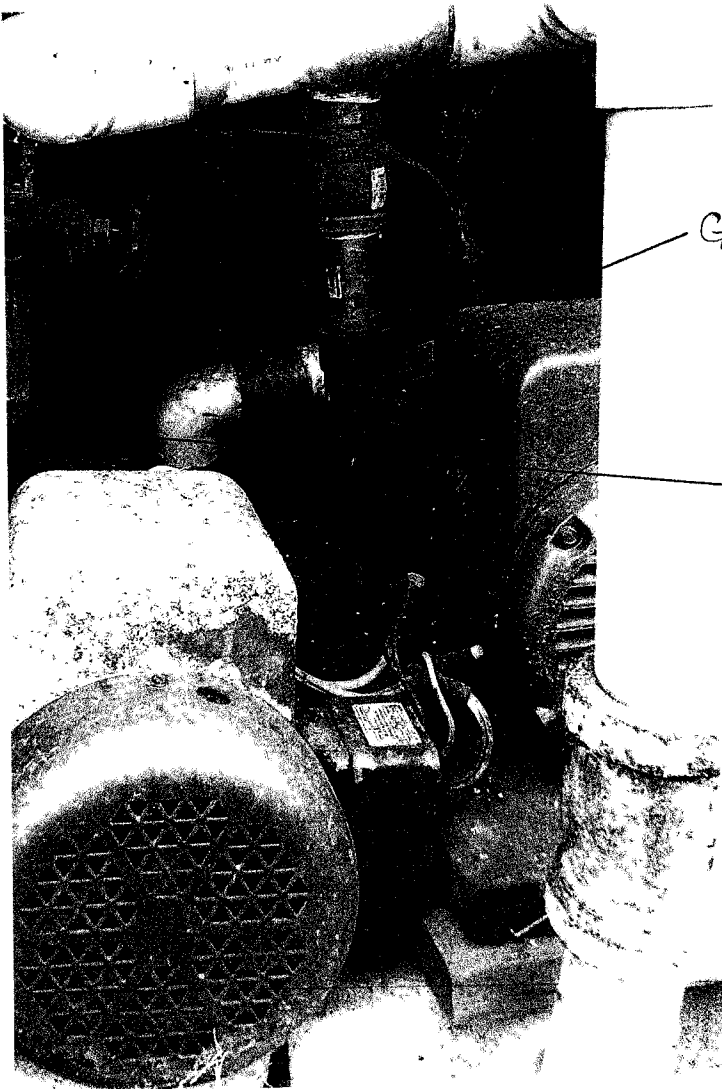

GOULDS MODEL 3BF1J1A0

MYERS MODEL 150M5

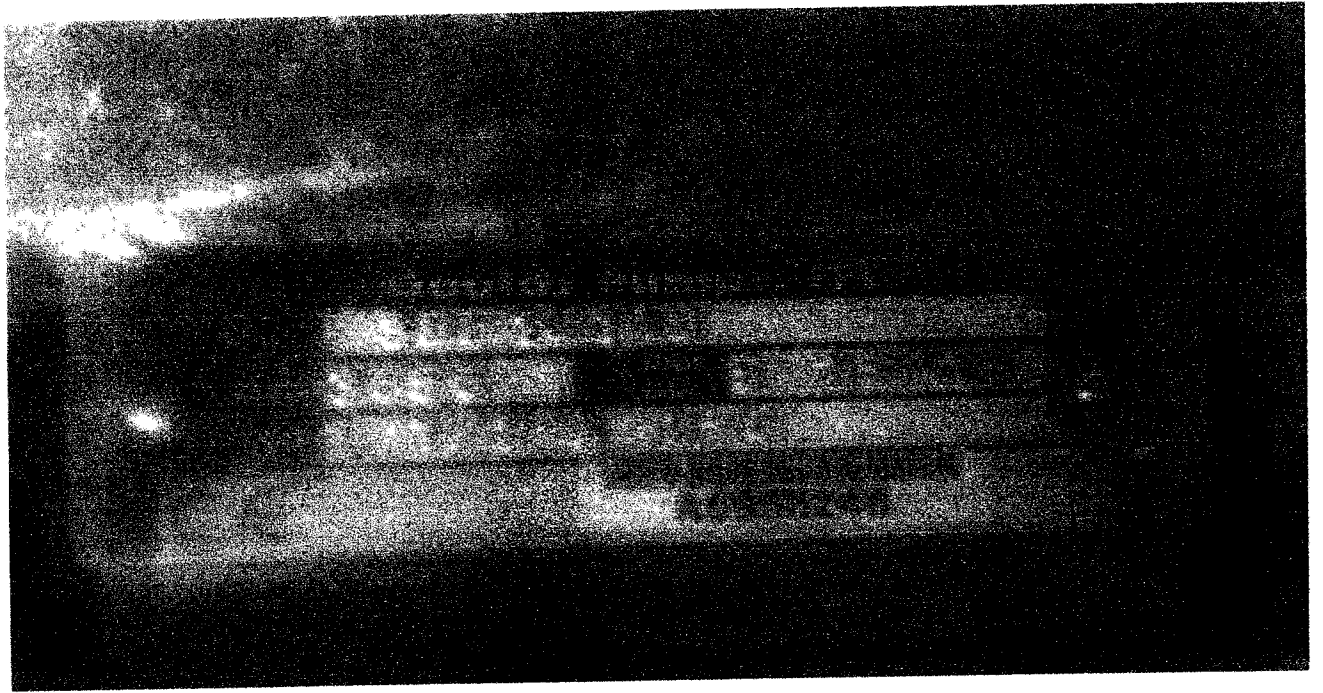



CATALOG NUMBER



SERIAL NO.

EXEM. DATE.

22034


Commercial Water

PERFORMANCE CURVES – 60 HZ, 3500 RPM CURVAS DE DESEMPEÑO – 60 HZ, 3500 RPM

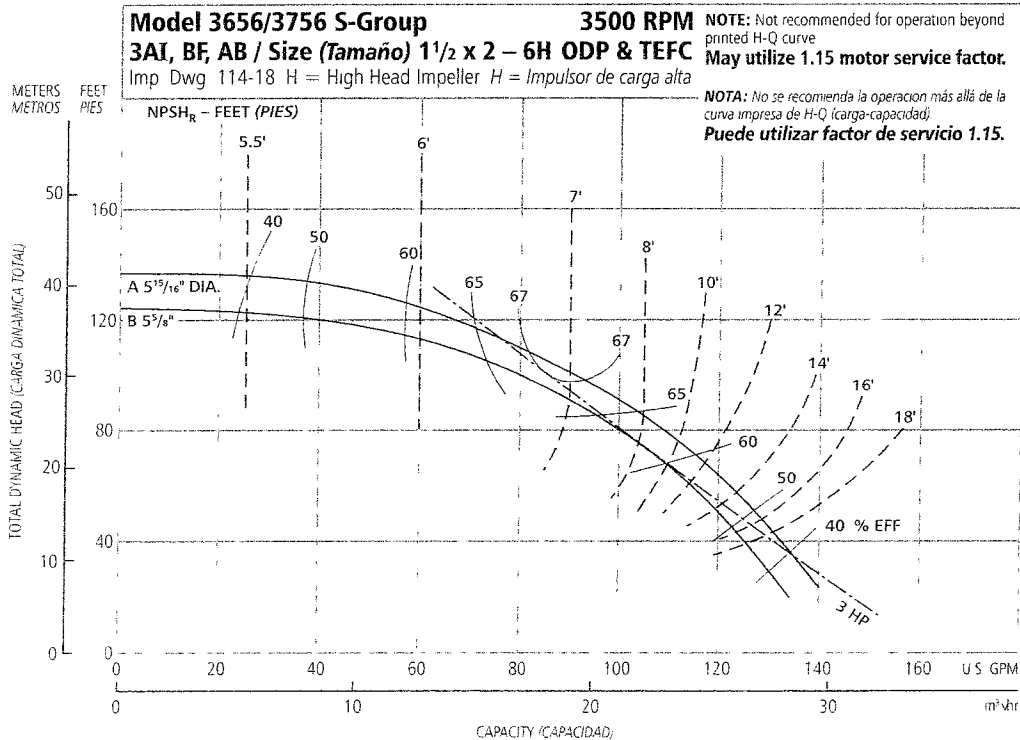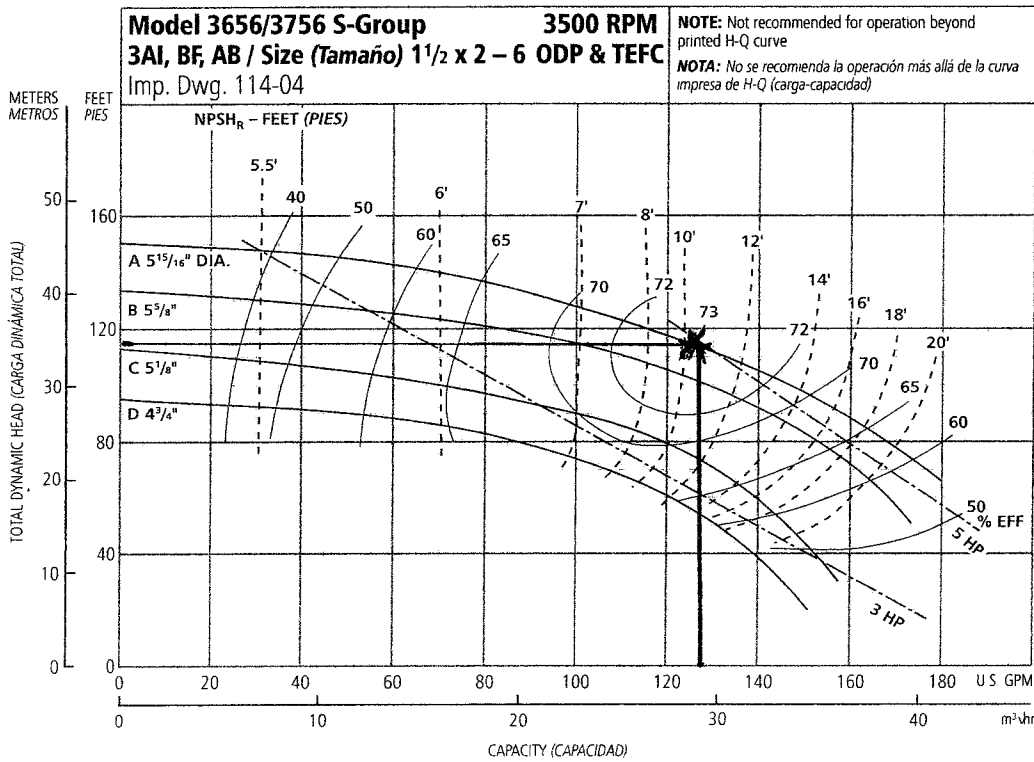


MYERS® Centri-Thrift™ Centrifugal Pumps


PUMP PERFORMANCE - 125M

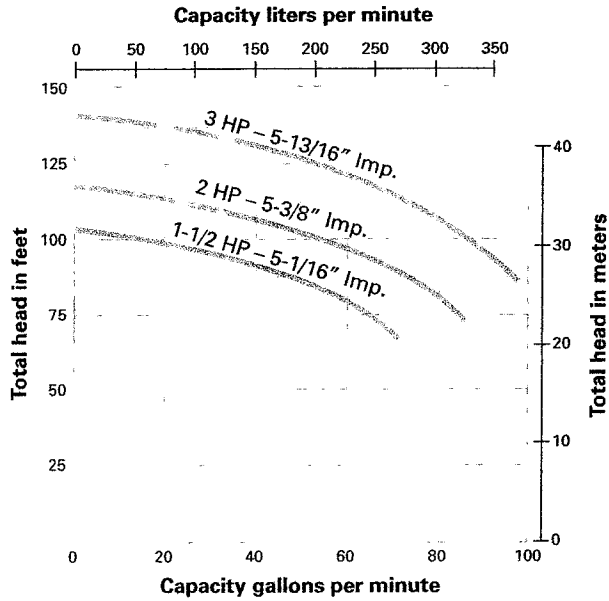


PUMP PERFORMANCE - 125B

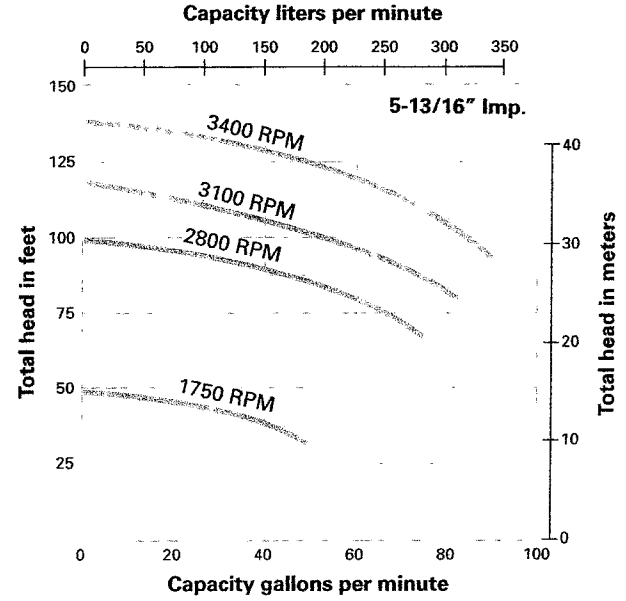

PUMP PERFORMANCE - 150M

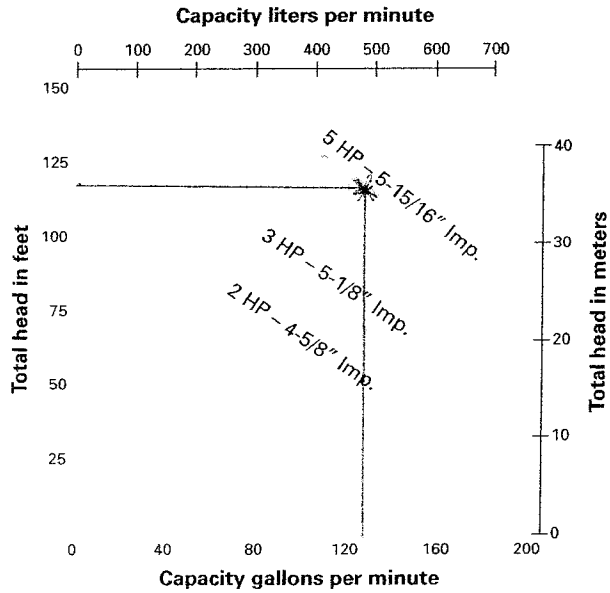

PUMP PERFORMANCE - 150B

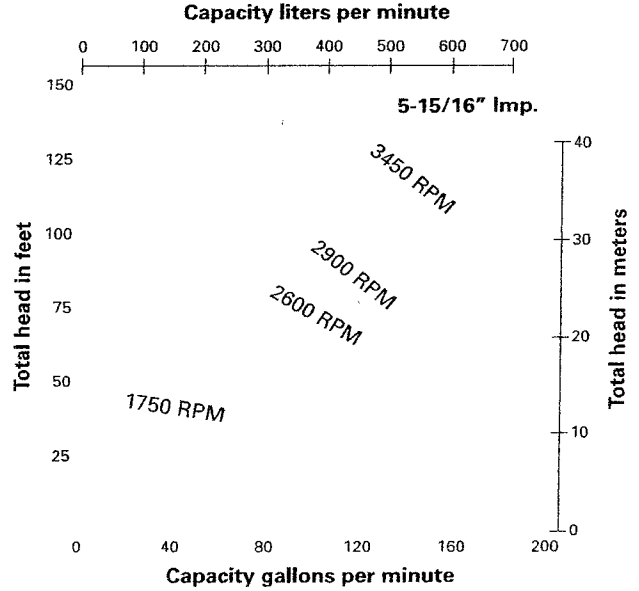

Bryan W. Shaw, Ph.D., *Chairman*
Carlos Rubinstein, *Commissioner*
Toby Baker, *Commissioner*
Zak Covar, *Executive Director*

110
TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 6, 2013

Ms. Peggy Paul, President
Orbit Systems, Inc.
1302 Airline N.
Rosharon, Texas 77583-7718


Re: Comprehensive Compliance Investigation at:
Mooreland Subdivision Water System, 263 CR 291(A) - 720 CR 296(A), Brazoria County,
Texas TCEQ ID No. 0200094, RN101236081, Investigation No. 1054183

Dear Ms. Paul:

On January 16, 2013, Ms. Elaine Jackson of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation; however, during the investigation, the investigator resolved apparent instances of noncompliance noted during the previous investigation dated November 2, 2009. Information has been provided which appears to indicate that this outstanding problems has been corrected. No further response from you is necessary concerning this investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Ms. Elaine Jackson in the Houston Region Office at (713)767-3650.

Sincerely,



Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/ETJ/ra

cc: The Brazoria County Environmental Health Dept.

Enclosure: Summary of Investigation Findings

Summary of Investigation Findings

MOORELAND SUBDIVISION WATER SYSTEM

Investigation #
1054183
Investigation Date: 01/16/2013

, BRAZORIA COUNTY,

Additional ID(s): 0200094

ALLEGED VIOLATION(S) NOTED AND RESOLVED ASSOCIATED TO A NOTICE OF VIOLATION

Track No: 380227

30 TAC Chapter 290.46(v)

Alleged Violation:

Investigation: 780207

Comment Date: 10/27/2009

Operating Practices for Public Water Systems

Failure to install all water system electrical wiring in compliance with a local or national electrical code.

Note: Failure to provide wiring in conduit at both plants.

Investigation: 1054183

Comment Date: 02/15/2013

Failure to provide wiring in conduit at both plants.

Recommended Corrective Action: Submit photo, invoice, or receipt to verify compliance.

Resolution: At the time of the investigation, the wiring was in conduit at both plants.

Track No: 380228

30 TAC Chapter 290.46(m)(4)

Alleged Violation:

Investigation: 780207

Comment Date: 10/26/2009

Water Leakage

Failure to maintain all distribution system lines and related appurtenances in a watertight condition. In this connection, the leaking distribution system lines located at the pressure gauge must be repaired or replaced as necessary.

Investigation: 1054183

Comment Date: 02/15/2013

Failure to repair leak in distribution at pressure gauge in plant 2.

Recommended Corrective Action: Submit a photo or work order showing that the pressure gauge has been replaced or repaired.

Resolution: At the time of the investigation, the pressure gauge was not leaking.

Track No: 380229

30 TAC Chapter 290.41(c)(3)(J)

Alleged Violation:

Investigation: 780207

Comment Date: 10/26/2009

Ground Water Sources and Development

Failure to repair the cracked concrete sealing block surrounding Well Number 2 with a properly constructed and installed sealing block.

Investigation: 1054183

Comment Date: 02/15/2013

Failure to repair concrete ceiling block found with cracks.

Recommended Corrective Action: Submit a photo, invoice or receipt to verify compliance.

Resolution: At the time of the investigation, the cracks were repaired in the concrete slab.

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 15, 2012

Ms. Peggy Paul, President
Orbit Systems Inc.
1302 Airline North Street
Rosharon, Texas 77583-7718

Re: Comprehensive Compliance Investigation at:
Ryan Long Subd. #2 W.S. 19144 CR 927 B, Brazoria County, Texas
Regulated Entity No.101277531 TCEQ ID No. 0200108, Investigation No.981333

Dear Ms. Paul:

On January 24, 2012, Ms. Elaine Jackson of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Ms. Elaine Jackson in the Houston Region Office at (713)767-3650.

Sincerely,



Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/ETJ/ra

cc: Brazoria Co. Environmental Health Dept.

TCEQ EXIT INTERVIEW FORM: Potential Violations and/or Records Requested

Regulated Entity/Site Name	Ryan Long Subd. #2 WS.		TCEQ Add. ID No. RN No. (optional)	0200108
Investigation Type	CCI	Purpose of Investigation	CCI	
Regulated Entity Contact	Ronnie Paul Manager	Telephone No.		Date Contacted 12/4/2018
Title		Fax No.		Date Faxed

NOTICE: The information provided in this form is intended to provide clarity to issues that have arisen during the investigation process between the TCEQ and the regulated entity named above and *does not represent final TCEQ findings related to violations*. Any potential or alleged violations discovered after the date on this form will be communicated by telephone to the regulated entity representative prior to the issuance of a notice of violation or enforcement. Conclusions drawn from this investigation, including additional violations or potential violations discovered (if any) during the course of this investigation, will be documented in a final investigation report.



Issue		Rule Citation (if known)	Description of Issue
No.	Type ¹		
1	AV		Repair barbed wire on fence protecting P.L.S.

For Records Request: identify the necessary records, the company contact and date due to the agency. For Alleged and Potential Violation issues: include the rule in question with the clearly described potential problem. Other type of issues: fully describe.

¹Issue Type Can Be One or More of: AV (Alleged Violation), PV (Potential Violation), O (Other), or RR (Records Request)

Did the TCEQ document the regulated entity named above operating without proper authorization?	<input type="checkbox"/> Yes	<input type="checkbox"/> No	
Did the investigator advise the regulated entity representative that continued operation is not authorized?	<input type="checkbox"/> Yes	<input type="checkbox"/> No	

Document Acknowledgment. Signature on this document establishes only that the regulated entity (company) representative received a copy of this document and associated continuation pages on the date noted. If contact was made by telephone, document will be faxed to regulated entity; therefore, signature not required.

 Investigator Name (Signed & Printed)	1/24/2018 Date	 Regulated Entity Representative Name (Signed & Printed)	1-29-12 Date
---	-------------------	---	-----------------

If you have questions about any information on this form, please contact your local TCEQ Regional Office.

Individuals are entitled to request and review their personal information that the agency gathers on its forms. They may also have any errors in their information corrected. To review such information, call 512-239-3282.

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 12, 2012

Ms. Peggy Paul, Owner
Orbit Systems, Inc.
1302 Airline N.
Rosharon, Texas 77583-7718


Re: Comprehensive Compliance Investigation at:
Angle Acres Water System, 128 Cindy Court, Angleton, Brazoria County, Texas
Regulated Entity No.101240109, TCEQ ID No.0200244, Investigation No. 990000

Dear Ms. Paul:

On January 12, 2012, Ms. Melody Kirksey of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Ms. Melody Kirksey in the Houston Region Office at (713)767-3650.

Sincerely,


Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/MK/ra

cc: Brazoria County Health Department

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 12, 2012

Ms. Peggy Paul, President
Orbit Systems Inc.
1302 Airline North Street
Rosharon, Texas 77583-7718

Re: Comprehensive Compliance Investigation at:
Country Acres Estates, 10 Wollam Loop, Alvin, Brazoria County, Texas
Regulated Entity No.: RN101270312, TCEQ ID No. 0200274, Investigation No. 981332

Dear Ms. Paul:

On January 24, 2012, Ms. Elaine Jackson of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Ms. Elaine Jackson in the Houston Region Office at (713)767-3650.

Sincerely,



Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/ETJ/ra

cc: Brazoria Co. Environmental Health Dept.

TCEQ EXIT INTERVIEW FORM: Potential Violations and/or Records Requested

Regulated Entity/Site Name	Country Acre Estate		TCEQ Add. ID No. RN No. (optional)	0200274
Investigation Type	Contact Made In-House (Y/N)	Purpose of Investigation	c-s-t	
Regulated Entity Contact	Barnier Paul	Telephone No.	Date Contacted	1/24/2012
Title	manager	Fax No.	Date Faxed	

NOTICE: The information provided in this form is intended to provide clarity to issues that have arisen during the investigation process between the TCEQ and the regulated entity named above and *does not represent final TCEQ findings related to violations*. Any potential or alleged violations discovered after the date on this form will be communicated by telephone to the regulated entity representative prior to the issuance of a notice of violation or enforcement. Conclusions drawn from this investigation, including additional violations or potential violations discovered (if any) during the course of this investigation, will be documented in a final investigation report.

Issue		Description of Issue
No.	Type ¹	
1	AV	Repair well house #2

For Records Request: identify the necessary records, the company contact and date due to the agency. For Alleged and Potential Violation issues: include the rule in question with the clearly described potential problem. Other type of issues: fully describe.

¹Issue Type Can Be One or More of: AV (Alleged Violation), PV (Potential Violation), O (Other), or RR (Records Request)

Did the TCEQ document the regulated entity named above operating without proper authorization?	<input type="checkbox"/> Yes	<input type="checkbox"/> No
Did the investigator advise the regulated entity representative that continued operation is not authorized?	<input type="checkbox"/> Yes	<input type="checkbox"/> No

Document Acknowledgment. Signature on this document establishes only that the regulated entity (company) representative received a copy of this document and associated continuation pages on the date noted. If contact was made by telephone, document will be faxed to regulated entity; therefore, signature not required.

	1/24/2012 Date		1/24/12 Date
Investigator Name (Signed & Printed)		Regulated Entity Representative Name (Signed & Printed)	

If you have questions about any information on this form, please contact your local TCEQ Regional Office. Individuals are entitled to request and review their personal information that the agency gathers on its forms. They may also have any errors in their information corrected. To review such information, call 512-239-3282.

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 12, 2012

Ms. Peggy Paul, President
Orbit Systems Inc.
1302 Airline North Street
Rosharon, Texas 77583- 7718

Re: Comprehensive Compliance Investigation at:
Blue Sage Gardens Subd., 5100 Blue Sage Dr., Brazoria County, Texas
Regulated Entity No. RN101178028, TCEQ ID No. 0200323, Investigation No. 981357

Dear Ms. Paul:

On January 26, 2012, Ms. Elaine Jackson of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Ms. Elaine Jackson in the Houston Region Office at (713)767-3650.

Sincerely,



Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/ETJ/ra

cc: Brazoria Co. Environmental Health Dept.

Eryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

March 8, 2012

Protecting Texas by Reducing and Preventing Pollution

Ms. Peggy Paul, President
Orbit Systems Inc.
1302 Airline North Street
Rosharon, Texas 77583-7718


Re: Notice of Violation for the Compliance Evaluation Investigation at:
Coronado Country, 4630 Apache Trail, Brazoria County, Texas
Regulated Entity No.: 101196319
TCEQ ID No.: 0200275, Investigation No.: 981325

Dear Ms. Paul:

On January 24, 2012, Ms. Elaine Jackson of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced regulated entity to evaluate compliance with applicable requirements for Public Water Supply. Enclosed is a summary which lists the investigation findings. During the investigation, a certain outstanding alleged violation was identified for which compliance documentation is required. Based on the information you have provided, the TCEQ has adequate documentation to resolve this alleged violation. Therefore, no further action is required.

If you or members of your staff have any questions, please feel free to contact Ms. Elaine Jackson in the Houston Region Office at 713/767-3650.

Sincerely,


Leticia DeLeon, PWS Team Leader
Houston Region Office

LD/ETJ/ra

cc: Brazoria County Environmental Health Dept.

Enclosures: Summary of Investigation Findings

Summary of Investigation Findings

CORONADO COUNTRY

Investigation # 981325

4630 APACHE TRL

Investigation Date: 01/24/2012

PEARLAND, BRAZORIA COUNTY, TX 77584

Additional ID(s): 0200275

ALLEGED VIOLATION(S) NOTED AND RESOLVED ASSOCIATED TO A NOTICE OF VIOLATION

Track No: 458802

30 TAC Chapter 290.46(v)

Alleged Violation:

Investigation: 981325

Comment Date: 2/15/2012

Operating Practices for Public Water Systems

Failure to install all water system electrical wiring in compliance with a local or national electrical code. At the time of the investigation, the electrical wiring was not in a conduit.

Recommended Corrective Action: Submit copy of photo or work order to verify that the electrical wiring is in a conduit.

Resolution: On February 10, 2012, a picture was faxed showing that the electrical wiring was in a conduit.

TCEQ EXIT INTERVIEW FORM: Potential Violations and/or Records Requested

Regulated Entity/Site Name	Carmen adto Country		TCEQ Add. ID No. RN No. (optional)	0200075
Investigation Type	Contact Made In-House (Y/N)	Purpose of Investigation		
Regulated Entity Contact	Bonnie Paul	Telephone No.		
Title	Manager	Fax No.	Date Contacted	1/24/2012
			Date Faxed	

NOTICE: The information provided in this form is intended to provide clarity to issues that have arisen during the investigation process between the TCEQ and the regulated entity named above and *does not represent final TCEQ findings related to violations.* Any potential or alleged violations discovered after the date on this form will be communicated by telephone to the regulated entity representative prior to the issuance of a notice of violation or enforcement. Conclusions drawn from this investigation, including additional violations or potential violations discovered (if any) during the course of this investigation, will be documented in a final investigation report.

Issue		Description of Issue
No.	Type ¹	
1	AV	Electrical wiring in conduit at well site

For Records Request: identify the necessary records, the company contact and date due to the agency. For Alleged and Potential Violation issues: include the rule in question with the clearly described potential problem. Other type of issues: fully describe.

¹Issue Type Can Be One or More of: AV (Alleged Violation), PV (Potential Violation), O (Other), or RR (Records Request)

Did the TCEQ document the regulated entity named above operating without proper authorization?	<input type="checkbox"/> Yes <input type="checkbox"/> No
Did the investigator advise the regulated entity representative that continued operation is not authorized?	<input type="checkbox"/> Yes <input type="checkbox"/> No

Document Acknowledgment. Signature on this document establishes only that the regulated entity (company) representative received a copy of this document and associated continuation pages on the date noted. If contact was made by telephone, document will be faxed to regulated entity; therefore, signature not required.

Investigator Name (Signed & Printed) Dave Jackson	Date 1/24/2012	Regulated Entity Representative Name (Signed & Printed) Bonnie Paul	Date 1-24-12
--	-------------------	--	-----------------

If you have questions about any information on this form, please contact your local TCEQ Regional Office.

Individuals are entitled to request and review their personal information that the agency gathers on its forms. They may also have any errors in their information corrected. To review such information, call 512-239-3282.

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

X 97

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 8, 2012

Mr. Peggy Paul, President
Orbits System Inc.
1302 Airline North
Rosharon, Texas 77583-7718


Re: Comprehensive Compliance Investigation at:
Rosharon Road Estates Subd., 8908 Rosharon Road, Rosharon, Brazoria Co., TX
TCEQ ID No: 0200346, Investigation No. 982357

Dear Ms. Paul:

On January 18, 2012, Mr. David. Livings R.S., of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Mr. David W. Livings in the Houston Region Office at (713)767-3650.

Sincerely,


Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/DWL/ra

Cc: Brazoria County Environmental Health Dept.

Enclosure: Summary of Investigation Findings.

Summary of Investigation Findings

ROSHARON ROAD ESTATES SUBDIVISION

Investigation # 982357

8908 ROSHARON ROAD ESTATES DR
ROSHARON, BRAZORIA COUNTY, TX 77583

Investigation Date: 01/18/2012

Additional ID(s): 0200346

No Violations Associated to this Investigation

ADDITIONAL ISSUES

Description

Item 1

Additional Comments

30 TEX. ADMIN. CODE, ' 290.104 (MCLs) Chemical Analysis


Failure to meet the commissions minimum standards noted in the most recent chemical analysis conducted by the certified laboratory which indicates the quality of the water produced by the system.

The most recent chemical analysis of the water sample collected on May 14, 2009, from this system reveals that the chloride manganese is above the minimum secondary constituent level.

Specifically, the chloride, and manganese concentration of 330 mg/L and 0.0673 mg/L, exceed the maximum permissible level for these constituent which is 300 mg/L and 0.05 mg/L respectively.

If any action is required to be taken, you will be notified by the Public Drinking Water Section of the TCEQ in Austin.

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

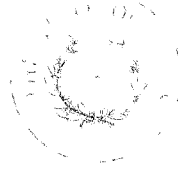

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 12, 2012

Mr. Peggy Paul, President
Orbits System Inc.
1302 Airline North
Rosharon, Texas 77583-7718

Re: Comprehensive Compliance Investigation at:
Grassland 11402 Airline Court, Rosharon, Brazoria County., Texas
TCEQ ID No: 0200360, Investigation No. 981706

Dear Ms. Paul:

On January 18, 2012, Mr. David. Livings R.S., of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Mr. David W. Livings in the Houston Region Office at (713)767-3650.

Sincerely,

Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/DWL/ra

Cc: Brazoria County Health Department

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 8, 2012

Ms. Peggy Paul, President
Orbits System Inc.
1302 Airline North
Rosharon, Texas 77583-7718


Re: Comprehensive Compliance Investigation at:
Rosharon Township, 16501 FM 521, Brazoria County., Texas
TCEQ ID No: 0200036, Investigation No. 982743

Dear Ms. Paul:

On January 18, 2012, Mr. David. Livings R.S., of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Mr. David W. Livings in the Houston Region Office at (713)767-3650.

Sincerely,


Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/DWL/ra

cc: Brazoria County Environmental Health Dept.

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 7, 2012

Ms. Peggy Paul, President
Obits System Inc.
1302 Airline North
Rosharon, Texas 77583-7718


Re: Comprehensive Compliance Investigation at:
Briar Meadows, CR 121 and CR 574, Brazoria County., Texas
TCEQ ID No: 0200410, Investigation No. 974264

Dear Ms. Paul:

On November 29, 2011, Mr. David W. Livings, R.S. of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Mr. David W. Livings in the Houston Region Office at (713)767-3650.

Sincerely,


Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/DWL/ra

Enclosure: Summary of Investigation Findings

cc: Brazoria County Health Department

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 7, 2012

Ms. Peggy Paul, President
Orbit Systems Inc.
1302 Airline North Street
Rosharon, Texas 77583-7718


Re: Notice of Violation for the Compliance Evaluation Investigation at:
Colony Cove Subdivision W. S. , 2311 Colony Cove, Brazoria County, Texas
Regulated Entity No.101192722, TCEQ ID No.0200324, Investigation No.981330

Dear Ms. Paul:

On January 24, 2012, Ms. Elaine Jackson of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced regulated entity to evaluate compliance with applicable requirements for Public Water Supply. Enclosed is a summary which lists the investigation findings. During the investigation, a certain outstanding alleged violation was identified for which compliance documentation is required. Based on the information you have provided, the TCEQ has adequate documentation to resolve this alleged violation. Therefore, no further action is required.

If you or members of your staff have any questions, please feel free to contact Ms. Elaine Jackson in the Houston Region Office at 713/767-3650.

Sincerely,


Leticia DeLeon, PWS Team Leader
Houston Region Office

LD/ETJ/ra

cc: Brazoria County Health Dept.

Enclosures: Summary of Investigation Findings

Summary of Investigation Findings

COLONY COVE SUBDIVISION WATER SYSTEM

Investigation # 981330

2311 COLONY CV

Investigation Date: 01/24/2012

ROSHARON, BRAZORIA COUNTY, TX 77583

Additional ID(s): 0200324

ALLEGED VIOLATION(S) NOTED AND RESOLVED ASSOCIATED TO A NOTICE OF VIOLATION

Track No: 458485

30 TAC Chapter 290.46(m)

Alleged Violation:

Investigation: 981330

Comment Date: 2/10/2012

Operating Practices for Public Water Systems

Failure to properly maintain the regulated entity by not repairing the damage well house buildings.

Recommended Corrective Action: Submit copy of photos or work orders to verify that the well houses have been repaired.

Resolution: On February 10, 2012, pictures were fax to show that the well house buildings were repaired.

TCEQ EXIT INTERVIEW FORM: Potential Violations and/or Records Requested

Regulated Entity/Site Name	Colony Cove Subd WS		TCEQ Add. ID No. RN No. (optional)	0200324
Investigation Type	Contact Made In-House (Y/N)	Purpose of Investigation	CCF	
Regulated Entity Contact	Bernie Paul	Telephone No.		Date Contacted
Title	Manager	Fax No.		Date Faxed
				1/24/2012



NOTICE: The information provided in this form is intended to provide clarity to issues that have arisen during the investigation process between the TCEQ and the regulated entity named above and *does not represent final TCEQ findings related to violations*. Any potential or alleged violations discovered after the date on this form will be communicated by telephone to the regulated entity representative prior to the issuance of a notice of violation or enforcement. Conclusions drawn from this investigation, including additional violations or potential violations discovered (if any) during the course of this investigation, will be documented in a final investigation report.

Issue		Description of Issue
No.	Type ¹	Rule Citation (if known)
1	AV	Repair well house buildings #1 & 2

¹Issue Type Can Be One or More of: AV (Alleged Violation), PV (Potential Violation), O (Other), or RR (Records Request)

Did the TCEQ document the regulated entity named above operating without proper authorization?	<input type="checkbox"/> Yes <input type="checkbox"/> No
Did the investigator advise the regulated entity representative that continued operation is not authorized?	<input type="checkbox"/> Yes <input type="checkbox"/> No

Document Acknowledgment. Signature on this document establishes only that the regulated entity (company) representative received a copy of this document and associated continuation pages on the date noted. If contact was made by telephone, document will be faxed to regulated entity; therefore, signature not required.

 Investigator Name (Signed & Printed)	1/24/2012 Date	 Regulated Entity Representative Name (Signed & Printed)
	1/24/12	Date

If you have questions about any information on this form, please contact your local TCEQ Regional Office. Individuals are entitled to request and review their personal information that the agency gathers on its forms. They may also have any errors in their information corrected. To review such information, call 512-239-3282.

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 7, 2012

Ms. Peggy Paul, President
Orbits System Inc.
1302 Airline North
Rosharon, Texas 77583-7718


Re: Comprehensive Compliance Investigation at:
Sandy Meadow Estates, 16805 East Sandy Meadows Dr., Rosharon, Brazoria Co., TX
TCEQ ID No: 0200335, Investigation No. 981876

Dear Ms. Paul:

On January 18, 2012, Mr. David. Livings R.S., of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Mr. David W. Livings in the Houston Region Office at (713)767-3650.

Sincerely,



Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/DWL/ra

cc: Brazoria County Environmental Health Dept.

Peggy Paul

From: Ronnie W. Paul [ronnie@orbitwater.net]
Sent: Thursday, February 09, 2012 11:30 AM
To: eljackso@tceq.state.tx.us
Cc: 'Peggy Paul'
Subject: Orbit Systems inspection response
Attachments: conduit at coronado.jpg; country acres bldg repair 1.jpg; country acres bldg repair 2.jpg; colony cove bldg repair 1.jpg; colony cove bldg repair 2.jpg; barb wire RLII (2).jpg; barb wire Mark V (1).jpg; site glass Riverside estates.jpg

Elaine,


Attached are the pictures of the issues you pointed in your recent visit to 8 of our water systems. Some pictures are not real good, but the photographers are not the best!

System/pictures


- 1 Coronado (0200275): conduit in well house
- 2 Country Acres (0200274): well house repair
- 3 Colony Cove (0200324): well house repairs (pics are work in progress from Jan.30; they did finish)
- 5 Blue Sage (0200323): no issues
- 17 Ryan Long 2 (0200108): barb wire repairs
- 18 Snug Harbor (0200053): no issues in review, but we are did barb wire repair and sealed slab (no picture)
- 27 Mark V (0200432): barb wire repair
- 28 Riverside (0200058): site glass installed

Let me know if you need anything else.

Ronnie (and Peggy) Paul
Orbit Systems
281-369-2041

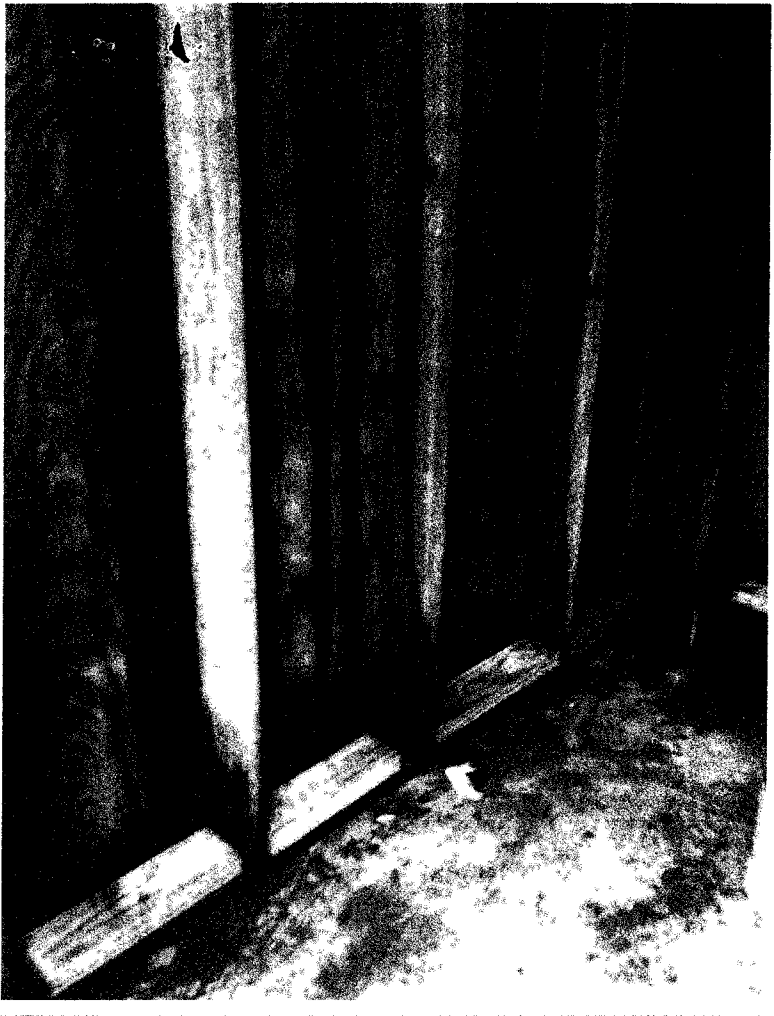

2

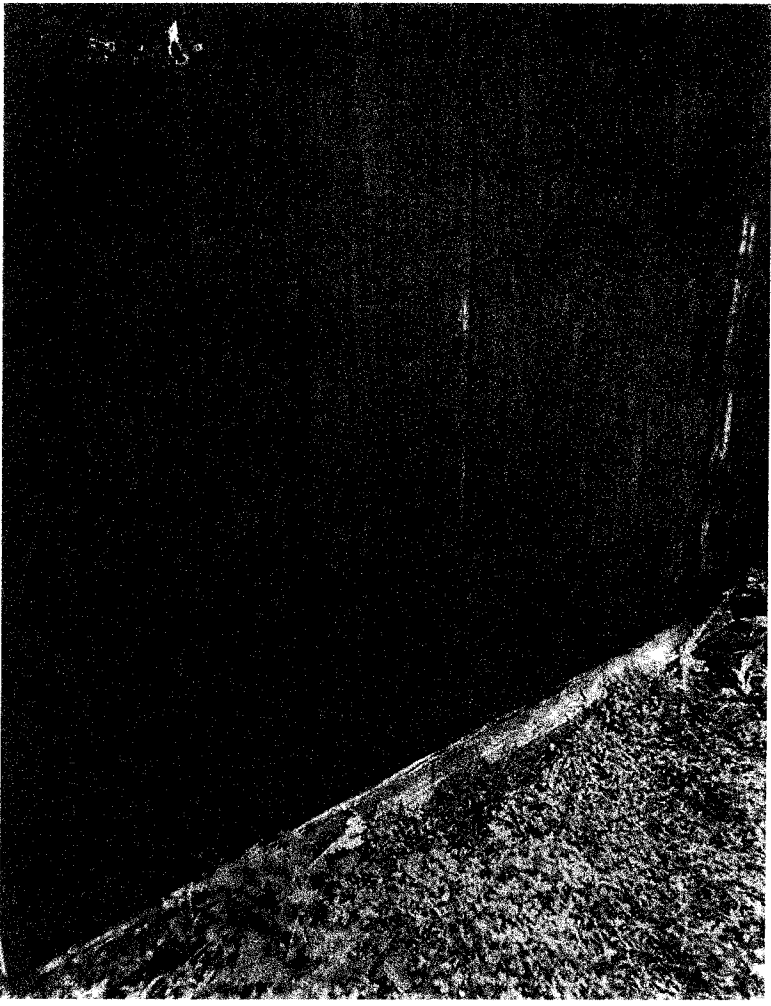

#(G) (Q)

#2

Peggy Paul

From: Ronnie W. Paul [ronnie@orbitwater.net]
Sent: Thursday, February 09, 2012 11:30 AM
To: eljackso@tceq.state.tx.us
Cc: 'Peggy Paul'
Subject: Orbit Systems inspection response
Attachments: conduit at coronado.jpg; country acres bldg repair 1.jpg; country acres bldg repair 2.jpg; colony cove bldg repair 1.jpg; colony cove bldg repair 2.jpg; barb wire RLII (2).jpg; barb wire Mark V (1).jpg; site glass Riverside estates.jpg

Elaine,

Attached are the pictures of the issues you pointed in your recent visit to 8 of our water systems. Some pictures are not real good, but the photographers are not the best!

System/pictures

- 1 Coronado (0200275): conduit in well house
- 2 Country Acres (0200274): well house repair
- 3 Colony Cove (0200324): well house repairs (pics are work in progress from Jan.30; they did finish)
- 5 Blue Sage (0200323): no issues
- 17 Ryan Long 2 (0200108): barb wire repairs
- 18 Snug Harbor (0200053): no issues in review, but we are did barb wire repair and sealed slab (no picture)
- 27 Mark V (0200432): barb wire repair
- 28 Riverside (0200058): site glass installed

Let me know if you need anything else.

Ronnie (and Peggy) Paul
Orbit Systems
281-369-2041



1

Peggy Paul

From: Ronnie W. Paul [ronnie@orbitwater.net]
Sent: Thursday, February 09, 2012 11:30 AM
To: eljackso@tceq.state.tx.us
Cc: 'Peggy Paul'
Subject: Orbit Systems inspection response
Attachments: conduit at coronado.jpg; country acres bldg repair 1.jpg; country acres bldg repair 2.jpg; colony cove bldg repair 1.jpg; colony cove bldg repair 2.jpg; barb wire RLII (2).jpg; barb wire Mark V (1).jpg; site glass Riverside estates.jpg

Elaine,

Attached are the pictures of the issues you pointed in your recent visit to 8 of our water systems. Some pictures are not real good, but the photographers are not the best!

System/pictures


- 1 Coronado (0200275): conduit in well house
- 2 Country Acres (0200274): well house repair
- 3 Colony Cove (0200324): well house repairs (pics are work in progress from Jan.30; they did finish)
- 5 Blue Sage (0200323): no issues
- 17 Ryan Long 2 (0200108): barb wire repairs
- 18 Snug Harbor (0200053): no issues in review, but we are did barb wire repair and sealed slab (no picture)
- 27 Mark V (0200432): barb wire repair
- 28 Riverside (0200058): site glass installed

Let me know if you need anything else.

Ronnie (and Peggy) Paul
Orbit Systems
281-369-2041



3-1

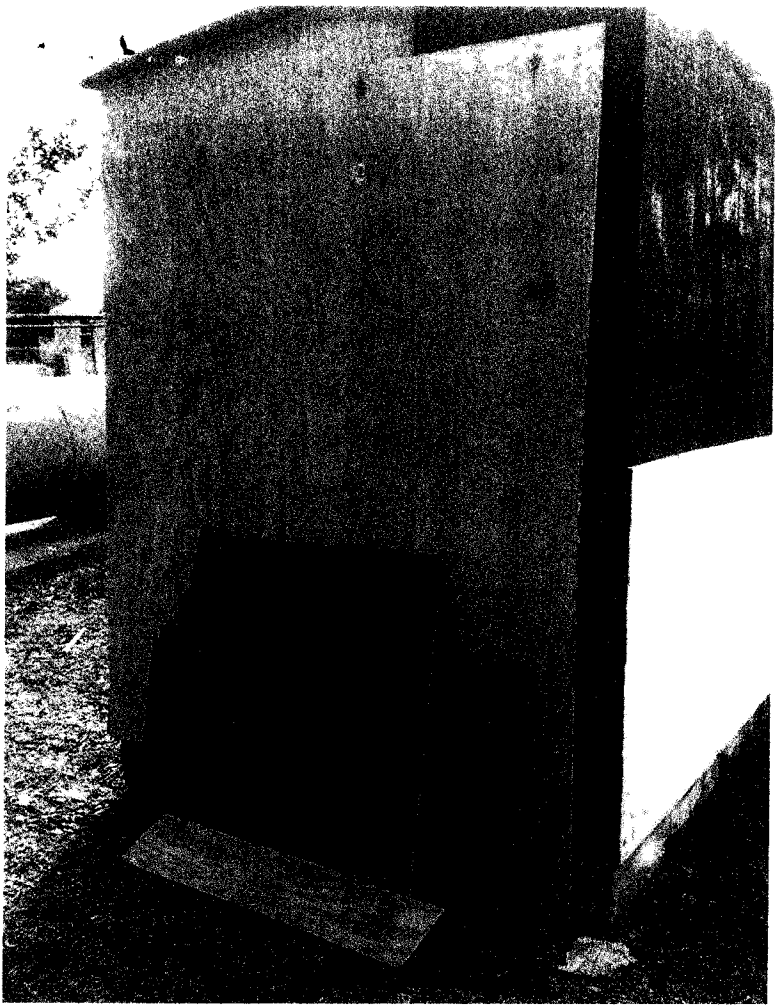

3-2

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*



14

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

January 17, 2012

Mr. Peggy Paul, President
Obits System Inc.
1302 Airline North
Rosharon, Texas 77583-7718

Re: Comprehensive Compliance Investigation at:
Country Meadows, 46 Country Meadow, Alvin, Brazoria County., Texas
TCEQ ID No: 0200273, Investigation No. 974650

Dear Ms. Paul:

On November 29, 2011, Mr. David W. Livings R.S., of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations were documented during the investigation

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Mr. David W. Livings R.S., in the Houston Region Office at 713-767-3650.

Sincerely,

Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/DWL/ra

Enclosure: Summary of Investigation Findings

cc: Brazoria County Environmental Health Department

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

January 4, 2012

Mr. Peggy Paul, President
Obits System Inc.
1302 Airline North
Rosharon, Texas 77583-7718


Re: Comprehensive Compliance Investigation at:
Brandi Estates, 8603 East Sherri Circle, Manvel, Brazoria County., Texas
TCEQ ID No: 0200325, Investigation No. 974447

Dear Ms. Paul:

On November 29, 2011, Mr. David W. Livings R.S., of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations were documented during the investigation. Please be aware that additional violations may be documented based upon further review of records of self-reporting.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Mr. David W. Livings R.S., in the Houston Region Office at 713-767-3650.

Sincerely,



Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/DWL/ra

Enclosure: Summary of Investigation Findings

Cc: Brazoria County Environmental Health Department

Peggy Paul

From: Ronnie W. Paul [ronnie@orbitwater.net]
Sent: Thursday, February 09, 2012 11:30 AM
To: eljackso@tceq.state.tx.us
Cc: 'Peggy Paul'
Subject: Orbit Systems inspection response
Attachments: conduit at coronado.jpg; country acres bldg repair 1.jpg; country acres bldg repair 2.jpg; colony cove bldg repair 1.jpg; colony cove bldg repair 2.jpg; barb wire RLII (2).jpg; barb wire Mark V (1).jpg; site glass Riverside estates.jpg

Elaine,

Attached are the pictures of the issues you pointed in your recent visit to 8 of our water systems. Some pictures are not real good, but the photographers are not the best!

System/pictures

- 1 Coronado (0200275): conduit in well house
- 2 Country Acres (0200274): well house repair
- 3 Colony Cove (0200324): well house repairs (pics are work in progress from Jan.30; they did finish)
- 5 Blue Sage (0200323): no issues
- 17 Ryan Long 2 (0200108): barb wire repairs
- 18 Snug Harbor (0200053): no issues in review, but we are did barb wire repair and sealed slab (no picture)
- 27 Mark V (0200432): barb wire repair
- 28 Riverside (0200058): site glass installed

Let me know if you need anything else.

Ronnie (and Peggy) Paul
Orbit Systems
281-369-2041



17

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 19, 2012

Ms. Peggy Paul, Owner
Orbit Systems, Inc.
1302 Airline N.
Rosharon, Texas 77583-7718


Re: Comprehensive Compliance Investigation at:
Beechwood Subdivision, Cobblestone Drive, Brazoria County, Texas
Regulated Entity No.101197648, TCEQ ID No.0200245 Investigation No.990006

Dear Ms. Paul:

On February 22, 2012, Ms. Melody Kirksey of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Ms. Melody Kirksey in the Houston Region Office at (713)767-3650.

Sincerely,



Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/MK/ra

cc: Brazoria County Environmental Health Department

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 8, 2012

Ms. Peggy Paul, President
Orbit Systems, Inc.
1302 Airline North
Rosharon, TX 77583-7718

Re: Comprehensive Compliance Investigation at:
Teleview Terrace Subdivision, 211 Broadmore Dr., Fresno, Fort Bend County, Texas
Regulated Entity No.101284610, TCEQ ID No.0790013, Investigation No.982080

Dear Ms. Paul:

On January 23, 2012, Mr. Huyen D. Luu, P.E. of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Mr. Huyen D. Luu in the Houston Region Office at (713)767-3650.

Sincerely,

Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/HDL/ra

cc: Fort Bend County Health Department

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*



13
TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 12, 2012

Ms. Peggy Paul, President
Orbit Systems Inc.
1302 Airline N
Rosharon, TX 77583-7718


Re: Comprehensive Compliance Investigation at:
Snug Harbor Subdivision, 512 Falmouth, Brazoria County, Texas
TCEQ ID No.0200053, Regulated Entity No.101277531, Investigation No.981333

Dear Ms. Paul:

On January 26, 2012, Ms. Elaine Jackson of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Ms. Elaine Jackson in the Houston Region Office at (713)767-3650.

Sincerely,


Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/ETJ/ra

cc: Brazoria Co. Environmental Health Dept.

Bryan W. Shaw, Ph.D., *Chairman*
Buddy Garcia, *Commissioner*
Carlos Rubinstein, *Commissioner*
Mark R. Vickery, P.G., *Executive Director*

TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

Protecting Texas by Reducing and Preventing Pollution

March 20, 2012

Ms. Peggy Paul, Owner
Orbit Systems, Inc.
1302 Airline N.
Rosharon, Texas 77583-7718


Re: Comprehensive Compliance Investigation at:
Bernard Oaks Subdivision, CR 244@59 Scotsdale St, Brazoria, Brazoria Co., Texas
Regulated Entity No.101283638, TCEQ ID No. 0200338, Investigation No. 990005

Dear Ms. Paul:

On February 22, 2012, Ms. Melody Kirksey of the Texas Commission on Environmental Quality (TCEQ) Houston Region Office conducted an investigation of the above-referenced facility to evaluate compliance with the applicable requirements for public water supply systems. No violations are being alleged as a result of the investigation.

The TCEQ appreciates your assistance in this matter and your compliance efforts to ensure protection of the State's environment. If you or members of your staff have any questions regarding these matters, please feel free to contact Ms. Melody Kirksey in the Houston Region Office at (713)767-3650.

Sincerely,



Leticia De Leon, Team Leader
Public Water Supply
Houston Region Office

LD/MK/ra

cc: Brazoria County Environmental Health Department